


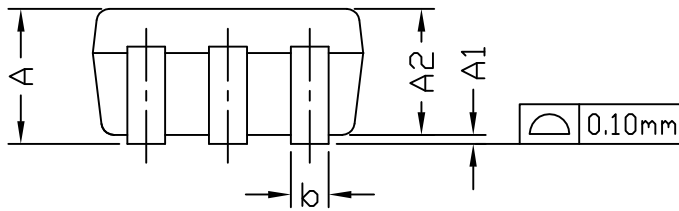


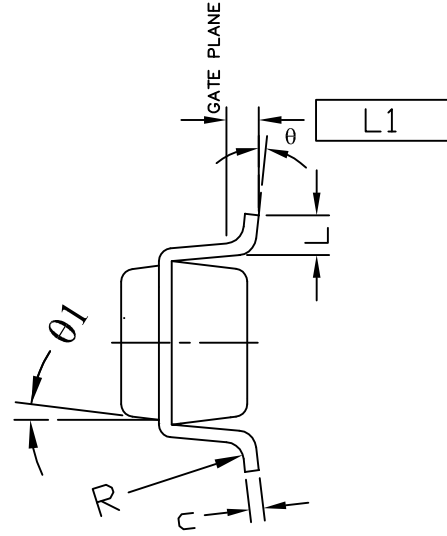

SC70\_5L PACKAGE OUTLINE

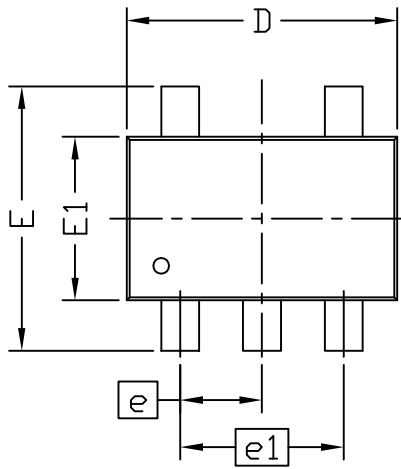

RECOMMENDED LAND PATTERN

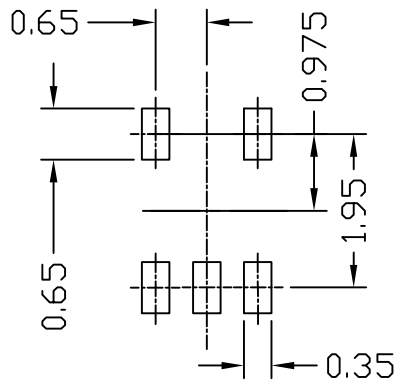

UNIT: mm

SYMBOLS	DIMENSIONS IN MILLIMETERS			DIMENSIONS IN INCHES		
	MIN	NOM	MAX	MIN	NOM	MAX
A	0.90	0.95	1.10	0.035	0.037	0.043
A1	0.00	—	0.10	0.00	—	0.004
A2	0.7	0.9	1.00	0.028	0.035	0.039
b	0.15	0.22	0.30	0.006	0.016	0.012
c	0.08	0.127	0.20	0.003	0.005	0.008
D	2.10 BSC			0.083 BSC		
E	2.30 BSC			0.091 BSC		
e	0.65 BSC			0.026 BSC		
e1	1.30 BSC			0.051 BSC		
E1	1.30 BSC			0.051 BSC		
L	0.26	0.40	0.46	0.010	0.015	0.018
L1	0.254 BSC			0.01 BSC		
R	0.1	—	—	0.004	—	—
theta	0°	4°	8°	0°	4°	8°
theta1	7° NOM			7° NOM		

NOTE

- ALL DIMENSIONS ARE IN MILLIMETERS.
- DIMENSIONS ARE INCLUSIVE OF PLATING.
- PACKAGE BODY SIZES EXCLUDE MOLD FLASH AND GATE BURRS.  
MOLD FLASH AT THE NON-LEAD SIDES SHOULD BE LESS THAN 3 MILS EACH.
- DIE IS FACING UP FOR MOLD AND FACING DOWN FOR TRIM/FORM.  
ie: REVERSE TRIM/FORM.
- DIMENSION L IS MEASURED IN GAUGE PLANE.
- CONTROLLING DIMENSION IS MILLIMETER.  
CONVERTED INCH DIMENSIONS ARE NOT NECESSARILY EXACT.